

Standard Installation

DENALI

TREE MOUNT - INTEGRAL



Flammable



Warning



High Voltage



Hot Surface

TOOLS NEEDED:	
	5/32", 3/16", 0.050", & 5/64" Allen Wrench
	Waterproof Wire Connectors
	Phillips Screwdriver

INSTRUCTIONS PERTAINING TO A RISK OF FIRE, OR INJURY TO PERSONS IMPORTANT SAFETY INSTRUCTIONS

Lighted fixture is HOT!

WARNING - To reduce the risk of FIRE OR INJURY TO PERSONS:

Turn off/unplug and allow to cool before replacing lamp/LED. Fixture gets HOT quickly! Contact only switch/plug when turning on. Do not touch hot lens, guard, or enclosure. Keep fixture away from materials that may burn. Do not operate the luminaire fitting with a missing or damaged shield. Do not touch the source at any time. Use a soft cloth or gloves. Oil from skin may cause damage.

SAVE THESE INSTRUCTIONS

IMPORTANT SAFETY INFORMATION - READ, FOLLOW, AND SAVE ALL SAFETY AND INSTALLATION INSTRUCTIONS

- Product must be installed by a qualified person in a manner consistent with its intended use and in compliance with the National Electrical Code, Canadian Electrical Code, and all Local and Provincial Codes.
- Follow product label information and instructions.
- Qualified Personnel with appropriate personal protective equipment must perform all servicing of this product.
- Before wiring to power supply and during servicing, turn off and lock out power at fuse or circuit breaker before service.
- The use of accessory equipment not recommended by the manufacturer or installed contrary to instructions may cause an unsafe condition. The use of damaged components may cause an unsafe condition and void product warranty.
- Do not block light emanating from product in whole or part, as this may cause an unsafe condition.
- Never operate the fixture with missing or damaged lens. Lens must be cleaned on regular basis.
- Entire fixture may become extremely hot. Do not touch hot lens or fixture body.
- Replace LED assembly only with correct wattage and type of power supply appropriate for LED assembly.
- All gaskets, o-rings and sealing surfaces must be kept clean during installation and service; failure to do this may cause an unsafe condition and void product warranty.


IMPORTANT LISTINGS AND CERTIFICATIONS

- Suitable for wet locations

This set of instructions works for:

DE-TM
Denali Series

For integral fixture configurations

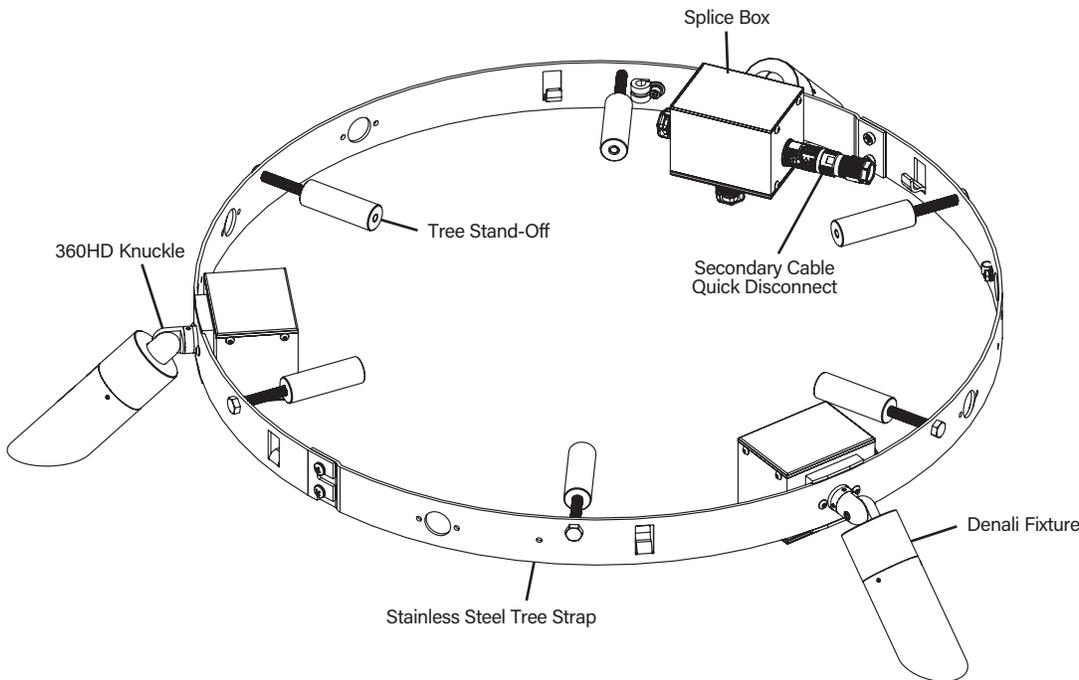

IMPORTANT SAFETY INFORMATION - READ, FOLLOW, AND SAVE THESE INSTALLATION INSTRUCTIONS


B-K LIGHTING

40429 Brickyard Drive • Madera, CA 93636 • USA
559.438.5800 • FAX 559.438.5900
www.bklighting.com • info@bklighting.com

RELEASE DATE
02/09/2024

REFERENCE NUMBER
INS-2808-00

THIS DOCUMENT CONTAINS PROPRIETARY INFORMATION OF B-K LIGHTING, INC. AND ITS RECEIPT OR POSSESSION DOES NOT CONVEY ANY RIGHTS TO REPRODUCE, DISCLOSE ITS CONTENTS, OR TO MANUFACTURE, USE OR SELL ANYTHING IT MAY DESCRIBE. REPRODUCTION, DISCLOSURE OR USE WITHOUT SPECIFIC WRITTEN AUTHORIZATION OF B-K LIGHTING, INC. IS STRICTLY FORBIDDEN.

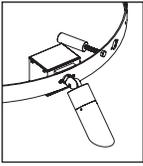


Standard Installation


DENALI

TREE MOUNT - INTEGRAL


Fixture Installation

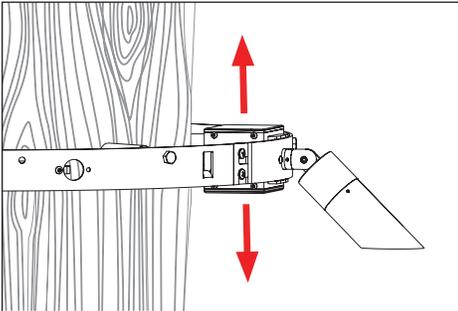


1. Place tree ring fixture around tree. Move fixture to desired height. Tighten the entire assembly to the tree with provided stand-offs.

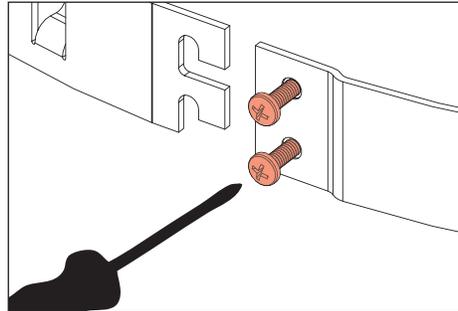


2. Secure by hooking end of strap over two (2) phillips screws. Secure by tightening two (2) phillips screws with phillips screwdriver.

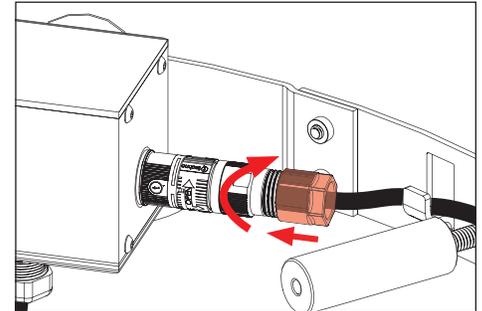


3. Connect secondary cable then twist to secure in place.

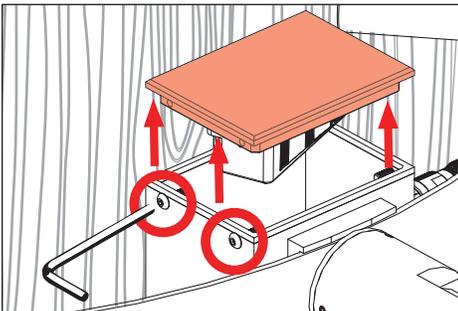

4. Remove top of transformer housing by removing four (4) #8-32 set screws using a 5/64" allen wrench.

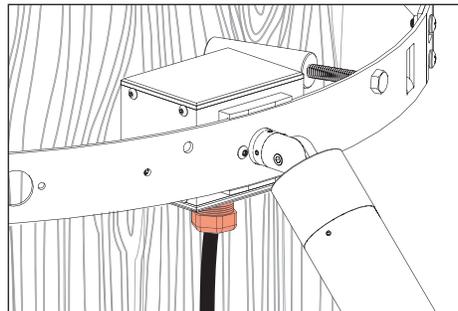


5. Bring line voltage cable from power line to main splice box location. Loosen cord grip on bottom of splice box, feed line voltage cable from power line through, then tighten cord grip to secure.

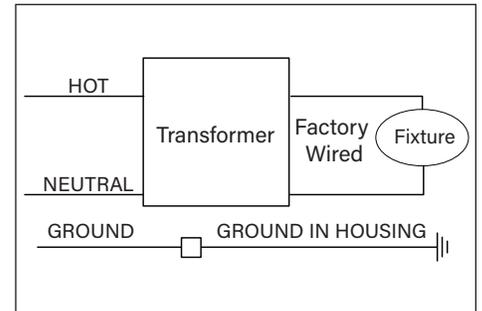

WIRING DIAGRAM

6. Make watertight connections from primary branch circuit to transformer with waterproof wire connectors (not included). Fixtures are pre-wired at factory on the secondary side. See wiring diagram.

⚠ Transformer housing will be marked for primary.

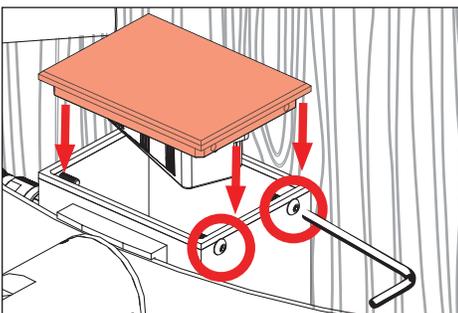

7. Replace top of transformer housing with four (4) #8-32 screws with a 5/64" allen wrench.

**IMPORTANT SAFETY INFORMATION LISTED ON REVERSE
READ, FOLLOW, AND SAVE ALL SAFETY AND INSTALLATION INSTRUCTIONS**




B-K LIGHTING

40429 Brickyard Drive • Madera, CA 93636 • USA
559.438.5800 • FAX 559.438.5900
www.bklighting.com • info@bklighting.com



RELEASE DATE
02/09/2024

REFERENCE NUMBER
INS-2808-00

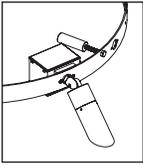

Standard Installation




360HD Knuckle

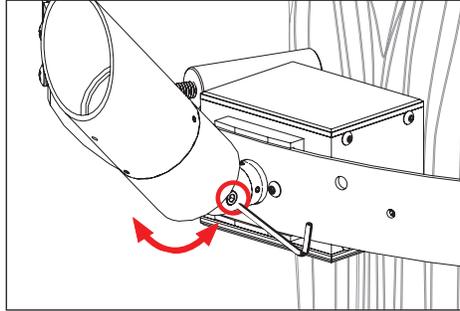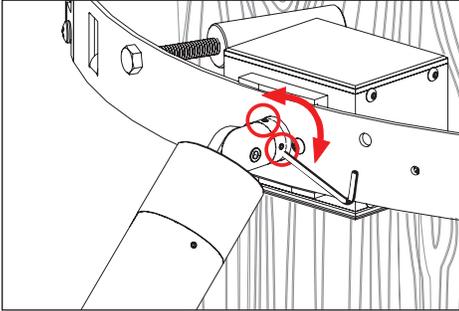

1. Use a 3/16" allen wrench to slightly loosen two (2) 3/8"-16 x 3/8" stainless steel black oxide set screw on the stem for 360° aiming purpose.
2. Rotate fixture at base and aim fixture to desired horizontal location.
3. Use a 3/16" allen wrench to loosen one (1) 1/4"-28 x 1-1/4" stainless steel black oxide socket head cap screw at the knuckle for vertical aiming purpose.
4. Tighten one (1) 3/8"-16 x 3/8" stainless steel black oxide set screw on the stem to secure horizontal aiming position. Tighten one (1) 1/4"-28 x 1-1/4" stainless steel black oxide socket head cap screw to 24" minimum to 48" maximum pounds to secure vertical aiming position.

Warning: Do not over tighten set screw. Doing so will compromise o-ring seal and will void warranty.


Replacing LED and/or Optics (x58-x63)

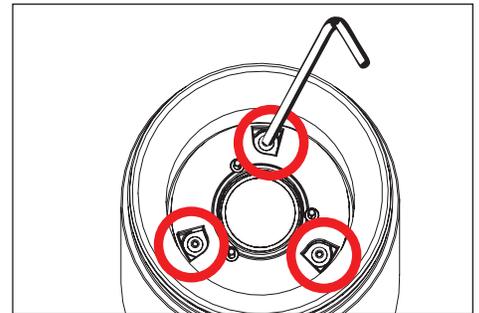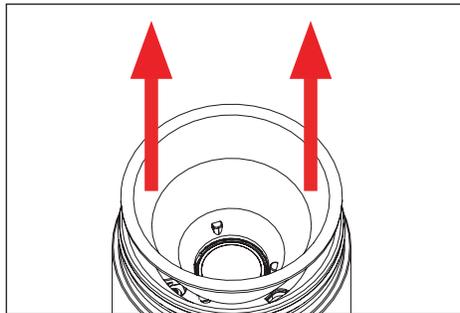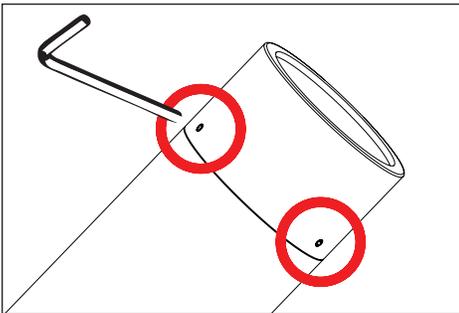


1. Use a 5/64" allen wrench to slightly loosen three (3) #8-32 stainless steel set screws to remove cap.
2. Remove optic by pulling gently and lift up.
3. Use a .050" allen wrench to loosen three (3) set screws holding optic holder and LED module.

**IMPORTANT SAFETY INFORMATION LISTED ON REVERSE
READ, FOLLOW, AND SAVE ALL SAFETY AND INSTALLATION INSTRUCTIONS**



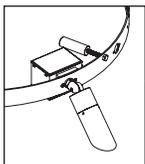


Standard Installation

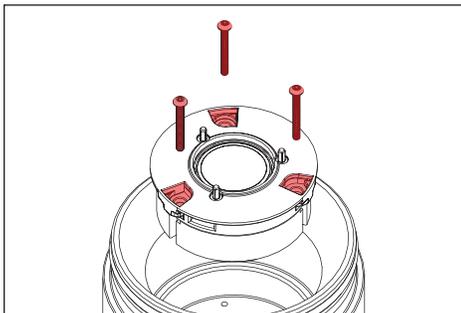


4. Gently lift LED module and disconnect from fixture. Install new LED module. Secure set screws through LED module and optic holder using a .050" allen wrench.

⚠ Do not pull on connector or wiring. Handle with care.

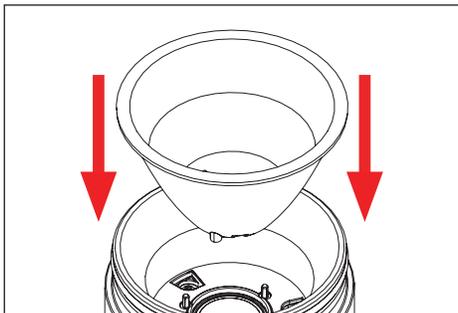

5. Replace optic by lining tabs with optic holder, then pressing down gently until secured into place.

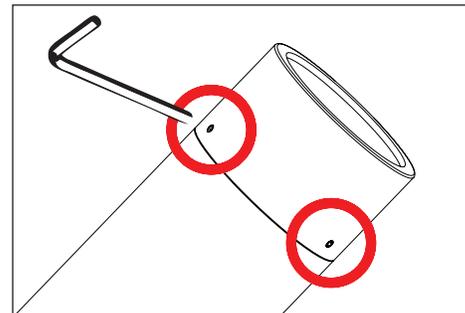

6. Place cap on fixture and tighten set screws. Tighten screw to 1/2 in-lbs. Top of screws should sit flush with fixture cap.

⚠ Warning: Do not over tighten set screws. Doing so will compromise o-ring seal and will void warranty.

**IMPORTANT SAFETY INFORMATION LISTED ON REVERSE
READ, FOLLOW, AND SAVE ALL SAFETY AND INSTALLATION INSTRUCTIONS**



B-K LIGHTING

40429 Brickyard Drive • Madera, CA 93636 • USA
559.438.5800 • FAX 559.438.5900
www.bklighting.com • info@bklighting.com

RELEASE DATE
02/09/2024

REFERENCE NUMBER
INS-2808-00